

4

3

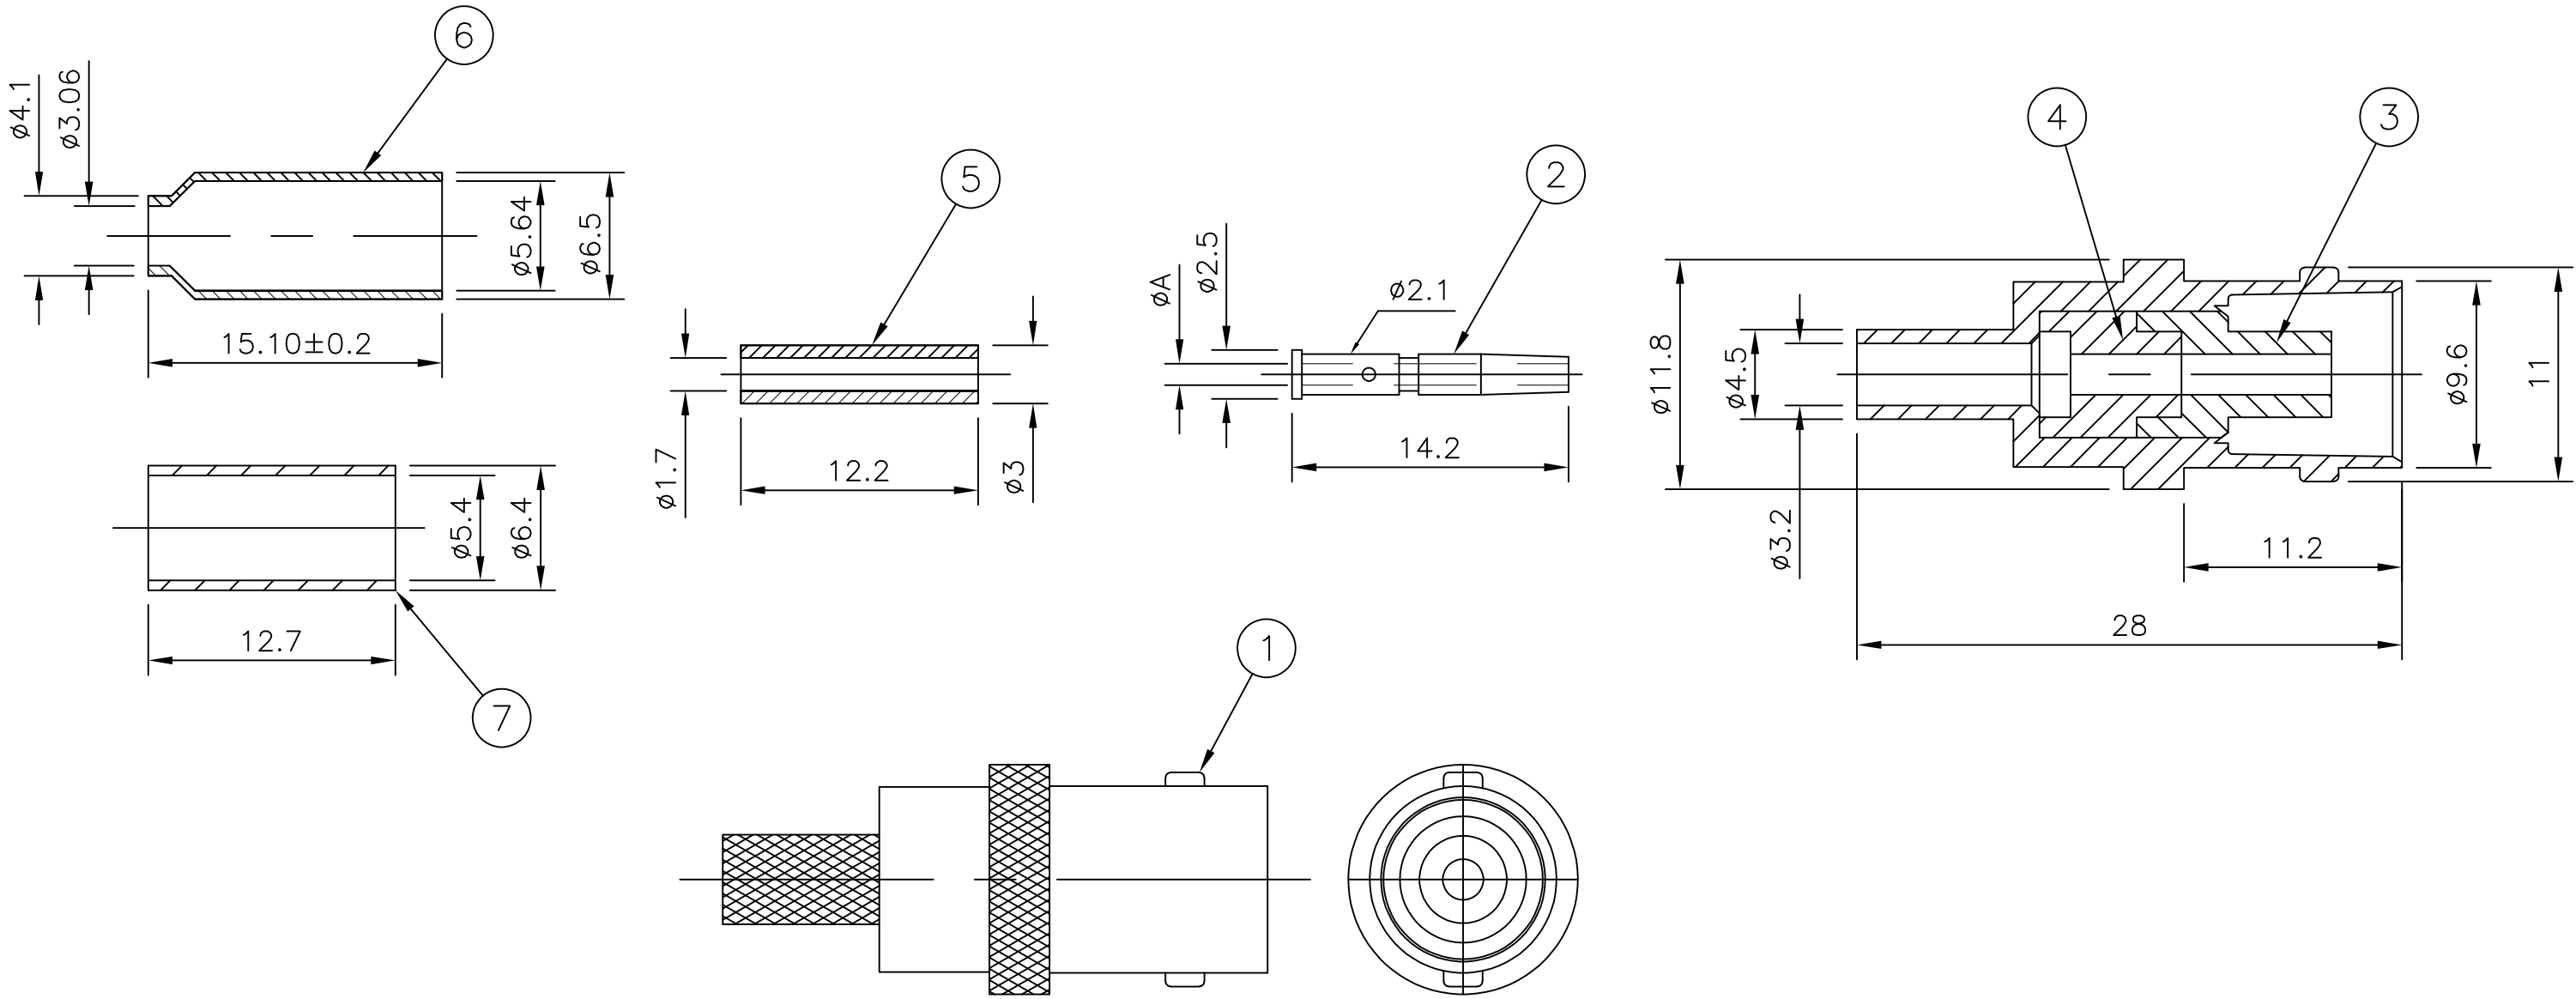
2

1

THIS DRAWING IS UNPUBLISHED.	RELEASED FOR PUBLICATION	JUNE , 2004.
© COPYRIGHT 2004 By -	ALL RIGHTS RESERVED.	

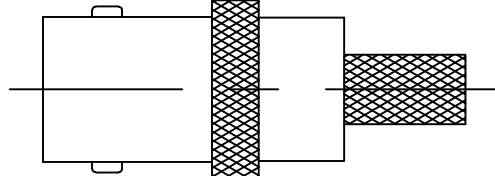




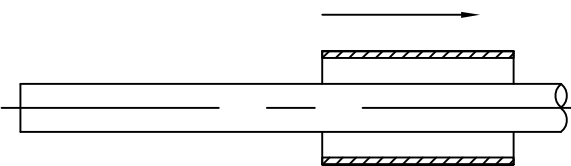
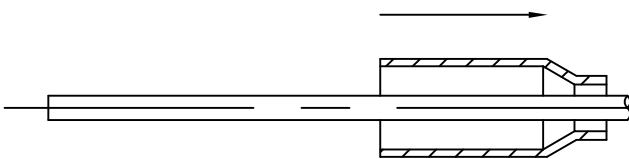
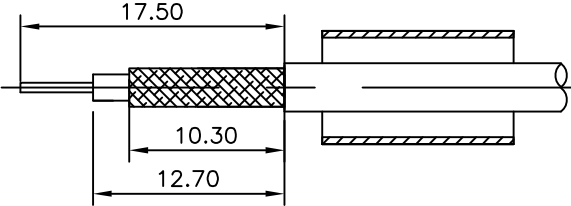
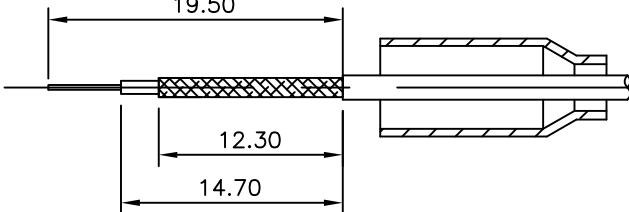
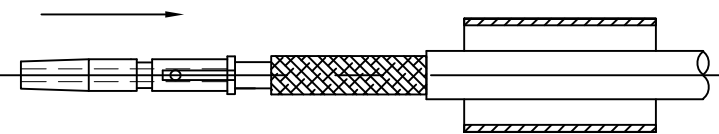
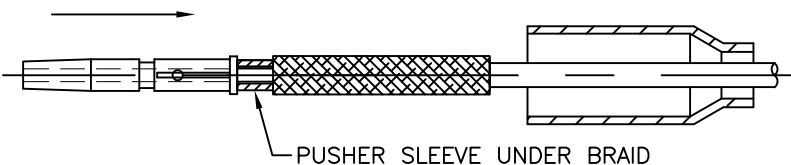


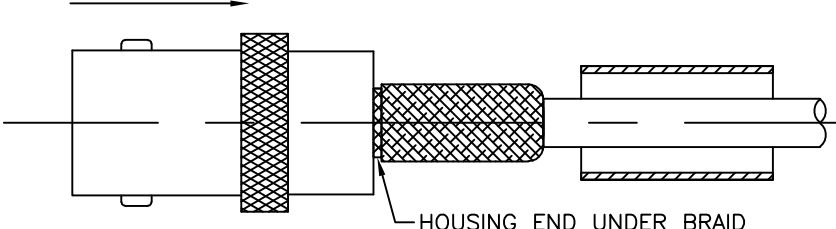
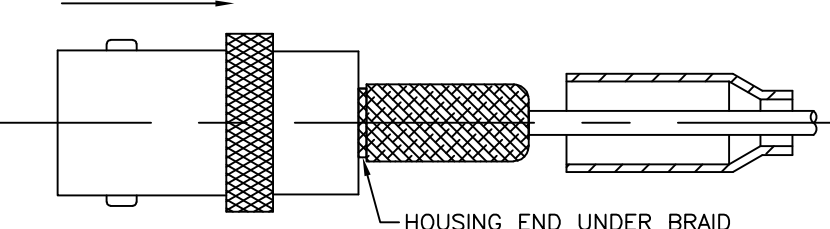
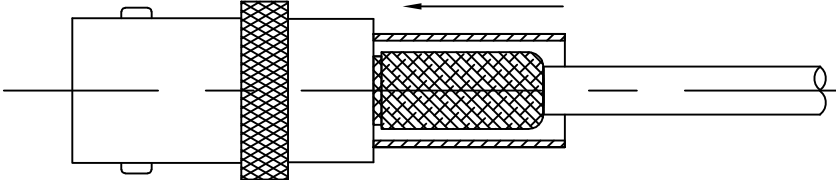
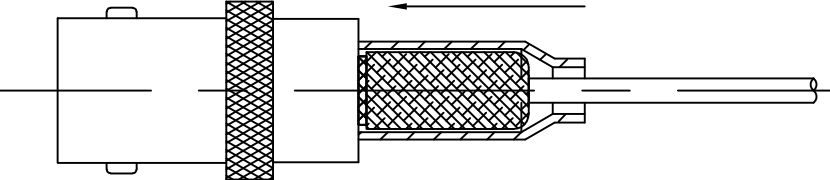
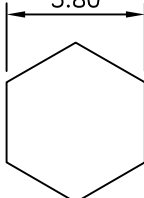
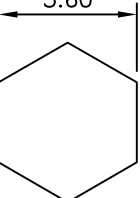

NOTES

- 1 IP PACK: 1PC/ONE BAG, 100PCS/INNER BOX, 1000PCS/OUTER BOX
- 2 BULK PACK: 100PCS/ONE BAG, 100PCS/INNER BOX, 1000PCS/OUTER BOX
- 3 Au PLATING OVER Ni PLATING OVER Cu PLATING
- 4 Ni PLATING OVER Cu PLATING
5. HAND TOOL: 9-1478240-0
6. DIE SET: SEE TABLE
7. FOR TECHNICAL DATA REFER TO YOUR LOCAL TYCO ELECTRONICS SALES OFFICE
8. ALL DIMENSIONS ARE NOMINAL FOR REFERENCE ONLY UNLESS OTHERWISE STATED



				1	1	-	-	Obsolete	
				-	-	1	1	BRASS	⚠ CRIMP SLEEVE 7
				-	-	1	1	BRASS	⚠ CRIMP SLEEVE 6
				-	-	1	1	NYLON	PUSHER SLEEVE 5
				1	1	1	1	POLYMETHYLPENTENE	INSULATOR 4
				1	1	1	1	POLYMETHYLPENTENE	INSULATOR 3
				1	1	1	1	PHOSPHOR BRONZE	⚠ CONTACT 2
				1	1	1	1	ZINC ALLOY	⚠ BODY 1
				5	35	25	15	MATERIAL	DESCRIPTION ITEM
				⚠	⚠	⚠	⚠		

THIS DRAWING IS A CONTROLLED DOCUMENT.		DWN	24 Feb 09	TE TE Connectivity			
		CHK	24 Feb 09				
		ANSON MA		NAME			
		APVD	24 Feb 09				
		BOB ZHAO		BNC STRAIGHT JACK CRIMP 50 OHM -			
		PRODUCT SPEC					
		108-112000		SIZE			
		APPLICATION SPEC					
		SEE SHEET 2		CAGE CODE			
		WEIGHT	-	DRAWING NO			
		CUSTOMER DRAWING		RESTRICTED TO			
		SCALE	NTS	SHEET			
		1 of 2		REV			
				D			

4		3		2		1	
THIS DRAWING IS UNPUBLISHED.		RELEASED FOR PUBLICATION		JUNE , 2004.			
© COPYRIGHT 2004 By -		ALL RIGHTS RESERVED.					
LOC	DIST	REVISIONS					
E	B	P	LTR	DESCRIPTION		DATE	DWN
			-	SEE SHEET 1		-	-
COMPONENTS							
		MAIN BODY (ITEM 1,3, & 4)		CONTACT (ITEM 2)		PUSHER SLEEVE (ITEM 5)	
							
							
							
ASSEMBLY INSTRUCTION							
CABLES: RG58C/U, 141A/U, URM43, 76, BELDEN 9907, KX 15				CABLES: RG174A/U, 188A/U, 316/U, URM95, KX 3B, KX 22A			
STEP 1 1. SLIDE METAL CRIMP FERRULE OVER CABLE 				STEP 1 1. SLIDE METAL CRIMP FERRULE OVER CABLE 			
STEP 2 1. STRIP CABLE TO DIMENSIONS AS SHOWN 				STEP 2 1. STRIP CABLE TO DIMENSIONS AS SHOWN 			
STEP 3 1. FIT CONTACT OVER CENTRE CONDUCTOR TO BUTT AGAINST DIELECTRIC. 2. CRIMP USING TOOL AS NOTES ON PAGE 1. 				STEP 3 1. SLIDE ITEM 10 PUSHER SLEEVE OVER DIELECTRIC BEFORE FITTING THE CONTACT. 2. FIT CONTACT OVER CENTRE CONDUCTOR TO BUTT AGAINST DIELECTRIC. 3. CRIMP USING TOOL AS NOTES ON PAGE 1. 			
RECOMMENDED CENTRE CONTACT A/F HEX 				RECOMMENDED CENTRE CONTACT A/F HEX 			
STEP 4 1. PRESS SUB-ASSEMBLY INTO BODY, UNTIL CONTACT IS FULLY LOCATED BY AN AUDIBLE CLICK. 2. ENSURE THAT KNURLED HOUSING INSERTS BETWEEN THE DIELECTRIC AND CABLE BRAID. 				STEP 4 1. PRESS SUB-ASSEMBLY INTO BODY, UNTIL CONTACT IS FULLY LOCATED BY AN AUDIBLE CLICK. 2. ENSURE THAT KNURLED HOUSING INSERTS BETWEEN THE PUSHER SLEEVE AND CABLE BRAID. 			
STEP 5 1. SLIDE CRIMP FERRULE ALONG THE CABLE UNTIL IT BUTTS AGAINST THE HOUSING BODY. 2. CRIMP USING TOOL AS NOTED ON PAGE 1. 3. CRIMP DIMENSION AS SHOWN. 				STEP 5 1. SLIDE CRIMP FERRULE ALONG THE CABLE UNTIL IT BUTTS AGAINST THE BODY HOUSING. 2. CRIMP USING TOOL AS NOTED ON PAGE 1. 3. CRIMP DIMENSION AS SHOWN. 			
RECOMMENDED CRIMP SLEEVE A/F HEX 				RECOMMENDED CRIMP SLEEVE A/F HEX 			
THIS DRAWING IS A CONTROLLED DOCUMENT.				DWN RITA ZUO 24 Feb 09 CHK ANSON MA 24 Feb 09 APVD BOB ZHAO 24 Feb 09 PRODUCT SPEC 108-112000 APPLICATION SPEC SHEET 2 WEIGHT - CUSTOMER DRAWING			
DIMENSIONS: MM 		TOLERANCES UNLESS OTHERWISE SPECIFIED: 0 PLC ± 0.5 1 PLC ± 0.3 2 PLC ± 0.2 3 PLC ± - 4 PLC ± - ANGLES ± - FINISH SEE TABLE		NAME BNC STRAIGHT JACK CRIMP 50 OHM - SIZE A2 CAGE CODE 00779 DRAWING NO C=1634511 RESTRICTED TO -		SCALE NTS SHEET 2 OF 2 REV D	